

RELEASE NOTES

General information	
Issue ID Number	1-HA8Z3
Product Name	Fiery EX12 v. 2.0 SP2
Issue Date	January 19, 2005

Files included in this release	
File name	File size
1-HA8Z3.ps	192 Kilobytes
relnotes.pdf	

Issue description
No longer able to scan or calibrate after installation of SP2

Steps to reproduce
<ol style="list-style-type: none">1. Let DC12 sit over night and go into power save mode.2. Send a print to the EX12. The DC12 will come out of Power Save mode and print document.3. Either Scan at CWS or PhotoShop or do a calibration.4. The EX12 will not go through the scan and just sit there. <p>Will need to reboot the EX12 in order to do a scan/calibration.</p>

Resolution type:	Closed - Patch
-------------------------	-----------------------

Resolution
1-HA8Z3

Important notes
To install this patch, download this file to the Direct Queue using Fiery Downloader or use the import function of CWS 4.x to import it. After the file has finished processing, please wait at least 60 seconds, then reboot the server from the Fiery LCD. When the Fiery has come to idle, print out the configuration page to confirm that the patch file has been received. The Update Info section should reflect the patch number: "1-HA8Z3".