



# Fiery Patch Release Notes

## General information

Defect ID number	1-18TDCY
Product name	Fiery Color Integrated Controller For Xerox Color 550/560
Release date	September 24, 2010

## Files included in this release

File name	File size
1-18TDCY.ps	159 KB

## Issue(s) addressed with this release

1. Issues with connecting to the Xerox Communication Server to register the printer for accurate automated meter reading and automatic supplies replenishment. (Xerox eSolutions)
2. CentreWare Internet Services link from Fiery Webtools does not open if network passes through a proxy server.

## Steps to reproduce the Issue(s)

1. **Issues with connecting to the Xerox Communication Server to register the printer for accurate automated meter reading and automatic supplies replenishment. (Xerox eSolutions)**
  - a. Goto WebTools via IP of the Fiery
  - b. Click on Xerox Center Ware link
  - c. Go to Properties
  - d. Select Services
  - e. Select Xerox Services
  - f. Select Xerox Communication Server
  - g. Click on Test Communication.
2. **CentreWare Internet Services link from Fiery Webtools does not open if network passes through a proxy server**
  - a. Setup network with a proxy server.
  - b. Using a browser (set to above proxy) launch Webtools.
  - c. Click on Xerox CentreWare link.

Result: Page will fail to launch since IP address 100.100.100.102 is not resolved by the proxy server.

## Before installing 1-18TDCY.ps



1. This patch is exclusive, it must be installed by itself, and the server must be rebooted or restarted once. After that, other patches can be applied to the server.
2. If any prerequisites listed below, they must be installed in the order specified before applying the **1-18TDCY.ps** patch:
  - **1-18OY91**
3. If any known issues listed below, read before installing **1-18TDCY.ps** patch:
  - **The eSolutions issue is partially addressed with 1-18TDCY.ps and will require patch 1-18WR77.ps for the eSolutions issue to be completely resolved.**

---

## Patch Installation Instruction

1. Make sure that the Fiery is Idle.
2. Import the patch file **1-18TDCY.ps** using Command Workstation to the Direct queue.
3. You must wait until the file finishes processing and CWS or LCD show Idle. This ensures the patch file is completely processed. User should wait **two** minutes for complete installation of patch.
4. From Command WorkStation, choose Server-> Reboot Server, or from the Fiery LCD, select Shut down -> Reboot System.
5. Wait until the Fiery comes to Idle and print the configuration page.
6. Verify that the **System Update Log** contains the patch number **1-18TDCY**.